

2019 Reserve Study Update

**Crescent Beach Condominium Association, Inc.
100 N. Collier Boulevard
Marco Island, FL 34145**



LCAM Resources • 5036 Dr. Phillips Blvd, Suite 207, Orlando FL 32819
info@lcamresources.com • www.lcamresources.com • 1-800-566-1770



October 22, 2018

Crescent Beach Condominium Association, Inc.
100 N. Collier Boulevard
Marco Island, FL 34145

Dear Board of Directors:

We are pleased to present you with this 2019 Reserve Study Report. The intent of this study is to anticipate future capital expenditures and provide a cash reserves funding plan to cover future repair or replacement expenses of the common property.

This report identifies the major assets maintained by the association. We have provided estimates on expected life, scheduled replacement date, and future replacement cost. This information was selected from a combination of market standards, cost database, historical information, and experience with similar properties.

Financial Summary

Actual 2018 Reserve Contribution:	\$290,568
Proposed 2019 Reserve Contribution, Straight-Line, Full Funding:	\$3,542,284
Proposed 2019 Reserve Contribution, 30-Year Cash Flow, Pooled:	\$1,436,194

This reserve study should serve as a useful tool for the association to determine the appropriate cash reserves necessary for adequate reserve funding over the long term. Actual reserves set aside are solely at the discretion of the association.

Thank you for allowing LCAM Resources the opportunity to serve you.

Respectfully submitted by:

LCAM Resources

J. Anthony Guadalupe, CCI
Managing Director



TABLE OF CONTENTS

Cover Page

Executive Summary

PART 1 • INTRODUCTION

About Your Reserve Study

Report Process

Straight-Line Vs. Pooling

Definitions

Terms & Conditions

Company Profile

PART 2 • PROPERTY PHOTOGRAPHS

PART 3 • RESERVE SCHEDULE

Straight Line Reserve Schedule

PART 4 • CASH FLOW PLAN

30-Year Cash Flow Projection (Pooled Reserves)

Year-by-Year Expenditures

PART 5 • CHARTS & GRAPHS

Component Current Cost By Category

Reserve Contribution Comparison

PART 6 • APPENDIX

Florida Statutory Reserve Requirements

Part 1: Introduction

This section contains general information about your reserve study and how to use this report.

INTRODUCTION

What is a Reserve Study?

A reserve study is a long-range budget planning tool for major repair and replacement of association property. This report will help you to anticipate and prepare for major expenditures by estimating when these events will occur and how much it will cost.

Your reserve study can be used to figure the amount to charge each owner for their share of reserves each year, and accurately disclose the status of your reserves.

This report is a “living document” that can evolve over time through updates, and be expanded as needed, to continue to serve your association for years to come.

Annual Budgets

The annual budget for most associations is actually comprised of two separate budgets added together:

- An “*operating budget*” that consists of annual *operating expenses* such as utilities, insurance, landscaping, management fees, etc. Capital expenses are usually not included in the operating budget unless they’re small expense items.
- A “*reserve budget*” consisting of capital replacement expenses such as roofs, streets, swimming pools, tennis courts, etc.

Reserve Expenses

These are major expenses that occur other than annually. Reserve expenses are reasonably predictable both in terms of frequency and cost. Common examples of reserve expenses include:

- Painting
- Paving
- Roofing
- Swimming Pools
- Mechanical Equipment

Examples of excluded items are electrical wiring and plumbing. These are deemed to have an estimated useful life equal to or exceeding the estimated useful life of the facility itself. Also excluded are insignificant expenses that may be covered either by an operating or reserve contingency, or otherwise in a general maintenance fund. Also excluded are expenses that are caused by acts of nature or accidents. These should be covered by insurance instead of reserves because they are unpredictable occurrences.

INTRODUCTION

Levels of Service

The following three categories describe the various types of Reserve Studies, from exhaustive to minimal.

I. FULL

A Reserve Study in which the following five Reserve Study tasks are performed:

- Component Inventory
- Condition Assessment (based upon on-site visual observations)
- Life and Valuation Estimates
- Fund Status
- Funding Plan

II. UPDATE WITH ON-SITE INSPECTION

A Reserve Study update in which the following five Reserve Study tasks are performed:

- Component Inventory (verification only, not quantification)
- Condition Assessment (based on on-site visual observations)
- Life and Valuation Estimates
- Fund Status
- Funding Plan

III. UPDATE WITHOUT SITE INSPECTION

A Reserve Study update with no on-site visual observations in which the following three Reserve Study tasks are performed:

- Life and Valuation Estimates
- Fund Status
- Funding Plan

INTRODUCTION

REPORT PROCESS

This report is a two-part study that examines both the physical and the financial.

Physical Analysis – During the physical analysis, we develop an inventory of all major assets of the association which require long-term replacement or repair. The assets are referred to as components. Typical components include roofing, painting, roads, swimming pools, tennis courts, and so on.

Components are selected based on a 4-part test:

- ✓ **Common area**
- ✓ **Limited useful life**
- ✓ **Predictable remaining life**
- ✓ **Major cost**

The condition of each reserve component is then evaluated in order to estimate remaining life and replacement cost.

Financial Analysis – The financial analysis examines the client’s level of reserve funding to determine the appropriate reserve contribution rate in the future. This recommendation is known as the “funding plan”.

Funding Plan

The funding plan consists of annual reserve contributions to offset accrued depreciation. Simply put, this means that funds are added to reserves each year to pay for the ongoing “wear and tear” of components.

Straight-Line Vs. Pooling

Straight-Line Reserve Schedule (Component Method) – The straight-line method provides for independent funding of each component, calculated separately to determine the annual reserve contribution required. This is a 1-year snapshot. Interest and inflation are not included due to the nature of straight-line formulas.


30-Year Cash Flow / Pooling Method – This alternate funding plan utilizes a cash flow method with “pooled reserves,” in which all reserve funds are combined into a single general account, or “pool” of funds. A 30-year cash flow analysis is then performed to determine the annual reserve contribution required to 1) pay for all future anticipated reserve expenditures, and 2) maintain a positive cash balance over time. All cost and life expectancy estimates for each component remain the same as in the straight-line method. However, unlike the straight-line method, this is a 30-year approach considers the effects of interest and inflation over time.

INTRODUCTION

Reserve Fund Status

The strength of your reserve funding is measured as percent funded:

Understanding Percent Funded

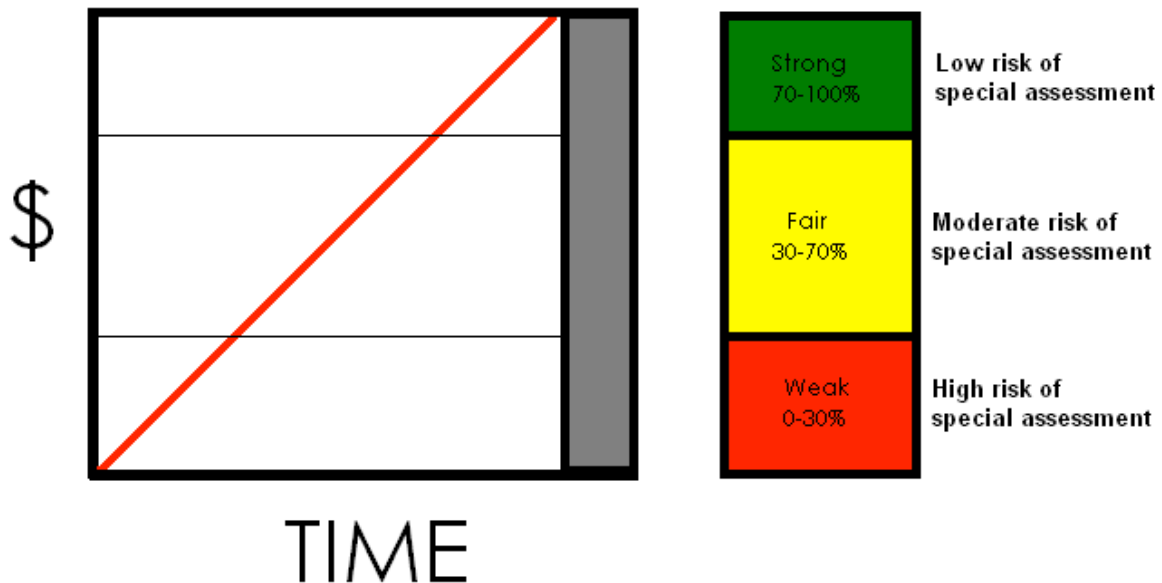

If reserves are in the 0-30% funding range, the fund is considered relatively weak and members are in a higher risk to expect special assessments. 30-70% funded is a fair position with moderate risk of special assessment. Associations in the 70%+ funding range are considered financially strong and special assessments are rare. (If the reserve account is over-funded, steps can be taken to bring it back into balance.)

INTRODUCTION

DEFINITIONS

Annual Assessment Increase - This represents the percentage rate at which the client will increase its assessment to reserves at the end of each year.

Assessment- the amount of money that should be allocated to reserves.

Budget Year Beginning/Ending - The budget year for which the report is prepared. For clients with fiscal years ending December 31st, the monthly contribution figures indicated are for the 12-month period beginning 1/1 and ending 12/31.

Capital Expenditure - an expenditure of funds for the purchase of an asset whose useful life is greater than one year in length; the replacement of an asset whose useful life is greater than one year in length; or the addition to an asset which extends the useful life of the previously existing asset for a period greater than one year in length.

Cash Flow Method: A method of developing a Reserve Funding Plan where annual reserve contributions are designed to offset the variable annual expenditures from the reserve fund to maintain a positive cash balance.

Component: The individual line items in the Reserve Study, developed or updated in the Physical Analysis. These elements form the building blocks for the Reserve Study. Components must meet the following criteria: 1) be the responsibility of the association, 2) have a *limited* expected life, 3) have a *predictable* life expectancy, 4) be above a minimum cost (for example, \$10,000 and above).

Component Inventory - The task of selecting and qualifying reserve components.

Component Method: A method of developing a Reserve Funding Plan where the total contribution is based on the sum of contributions for individual components.

Condition Assessment: The task of evaluating the current condition of the component based on observed or reported characteristics.

Contingency - Funds retained for the purpose of covering unexpected costs.

Current Replacement Cost - The estimated replacement cost effective at the beginning of the fiscal year for which the report is being prepared. See "Replacement Cost."

INTRODUCTION

Deferred Maintenance - the practice of postponing maintenance activities in order to save costs, meet budget funding levels, or realign available budget monies. The failure to perform needed repairs could lead to asset deterioration and ultimately asset impairment.

Expected Life / Estimated Useful Life - The estimated service life of a component if properly constructed / installed. Based upon industry standards, manufacturer specifications, visual inspection, location, usage, client standards and prior history. All of these factors are taken into consideration when tailoring the estimated useful life of a particular component.

Future Replacement Cost - The estimated cost to repair or replace the asset at the end of its estimated useful life based upon the current replacement cost and inflation.

Inflation - This figure is used to approximate the future cost to repair or replace components in the report.

Projected Reserve Balance - The anticipated reserve balance on the first day of the fiscal year for which this report has been prepared. This is based upon information provided and not audited.

Remaining Useful Life: The estimated time, in years, that a reserve component can be expected to continue to serve its intended function.

Replacement Cost: The cost of replacing, repairing, or restoring a Reserve Component to its original functional condition.

Replacement Year - The year that the asset is scheduled to be replaced.

Reserve Balance: Actual or projected funds intended to defray the future repair or replacement of major components which the association is obligated to maintain.

Special Assessment: An assessment levied on the members of an association in addition to regular assessments. Special Assessments are often regulated by governing documents or local statutes.

Straight Line Method: For each component, the annual reserve contribution equals the unfunded balance divided by remaining life, respectively.

Unfunded Balance: Current cost estimate minus year end balance.

Weighted Proportional Allocation: The total estimated reserve balance is allocated among each reserve category according to the “weight” of the category as a percentage of the whole. Recommended for re-distribution of restricted funds to bring balance across reserves (in the straight line method) when components are overfunded, unfunded, or deleted.

INTRODUCTION

Terms & Conditions

The reserve analysis contained in this report is qualified by certain assumptions, limiting conditions, and disclosures as set forth in this section:

Scope: The reserve study will be a reflection of information provided to the consultant and assembled for the association's use, not for the purpose of performing an audit, quality/forensic analyses, or background checks of historical records.

Reliance on Client Data: Information provided by the official representative of the association regarding financial, physical, quantity, or historical issues will be deemed reliable by the consultant.

Physical Analysis: All on-site observations were performed using non-destructive testing, representative sampling, and a combination of field measurements and drawing take-offs. For safety reasons, it is our procedure to observe pitched roofs from the ground; flat roofs are examined only when safe access is available.

Reserve Balance: The actual or projected total presented in the Reserve study is based upon information provided and was not audited.

Reserve Projects: Information provided about reserve projects will be considered reliable. Any on-site inspection should not be considered a project audit or quality inspection.

Sources: Cost estimates and useful life information are based on our experience with actual properties and a combination of association records, contractor interviews, and industry pricing and scheduling manuals. Opinions on the remaining useful life of the components contained in this report do not represent a guarantee or warranty of the components and should not be considered as such.

General: The individual(s) responsible for this reserve study preparation or oversight has no other involvements with the client association that could result in actual or perceived conflicts of interest. The conclusions and estimates presented in this report must be considered opinions and not facts. We reserve the right to modify this report, including conclusions. This reserve study is provided as an aid for planning purposes and not as an accounting tool. Since it deals with events yet to take place, there is no assurance that the results enumerated within it will, in fact, occur as described. The authors of this report shall not be required to give testimony or appear in court or at any administrative proceeding relating to this report. The liability of the authors of this report, Liberty Capital Asset Management Resources, LLC dba LCAM Resources and any other employees/contractors of LCAM Resources is limited to the fee collected for preparation of this report. Acceptance of, and/or use of, this report constitutes acceptance of the above conditions.

INTRODUCTION

Company Profile

LCAM Resources founded from a dedication to raise the bar in the community association industry. Our goal is to provide unprecedented superior service in capital reserve planning and insurance valuation. We build close professional relationships with property managers, board members, agents, and owners to act as a team with one common goal: to protect the long-term financial health of their organization. We are Business Partner members of the Community Associations Institute (CAI), a national organization committed to providing education and resources to community associations and the companies who serve them. Our professional staff has years of extensive experience with all property types throughout Florida and the United States.

Annual Update Service

The best way to keep your reserve program on track is through regular updates. We can recast a new 30-year report using current replacement cost and financial information to keep your reserve program on track. This affordable service is available with or without site inspection, and for only a fraction of your initial cost. Contact us for details and we would be more than happy to speak to you about the options available.

Part 2: Photographs

Current photographs are not available for this reserve study update (without inspection).

Please refer to your previous LCAM Resources reserve study with on-site inspection to view component photos.

Part 3: Reserve Schedule

This section contains your straight line, fully funded reserve schedule.

Annual reserve contributions are determined by taking the unfunded balance of each component, divided by remaining life.

Calculations are based on straight line accounting formulas and do not include interest or inflation.

RESERVE SCHEDULE**Straight Line Reserve Schedule**

Beginning Balance:	\$909,838
Fully Funded Reserves:	\$4,452,122
Percent Fully Funded as of 1/1/2019:	20%

Description	Cost Estimate	Expected Life	Replacement Year	Remaining Life	12/31/18 Balance*	Unfunded Balance	2019 Contribution
PAVING							
Brick Pavers, South Garage, Replace	\$8,200	30	2042	23	\$1,193	\$7,007	\$305
Paving, Asphalt Overlay	\$120,000	20	2027	8	\$17,463	\$102,537	\$12,817
Paving, Bomanite Reseal	\$32,000	5	2019	1	\$4,657	\$27,343	\$27,343
Seal Coat Blacktop areas	\$9,500	2	2019	1	\$1,382	\$8,118	\$8,118
Total	\$169,700				\$24,695	\$145,005	\$48,583
ROOFING							
Roofing, Mansard, Reroof	\$784,600	30	2020	1	\$114,176	\$670,424	\$670,424
Roofing, North Garage, Reroof	\$244,900	15	2020	1	\$35,638	\$209,262	\$209,262
Roofing, South Garage, Reroof	\$233,300	15	2020	1	\$33,950	\$199,350	\$199,350
Roofing, Tower, Replace	\$1,253,200	15	2020	1	\$182,368	\$1,070,832	\$1,070,832
Tiki Huts, Bicycle Storage, Re-thatch	\$5,000	4	2020	1	\$728	\$4,272	\$4,272
Tiki Huts, Pool, Re-thatch	\$2,000	8	2020	1	\$291	\$1,709	\$1,709
Total	\$2,523,000				\$367,151	\$2,155,849	\$2,155,849
PAINTING							
North & South Garage, Repaint & Repair	\$31,200	5	2020	1	\$4,540	\$26,660	\$26,660
Painting, Parking Lot Light Poles	\$3,400	5	2020	1	\$495	\$2,905	\$2,905
Painting, Exterior, Tower	\$233,500	7	2023	4	\$33,979	\$199,521	\$49,880
Painting, Interior Common Areas	\$51,300	7	2023	4	\$7,465	\$43,835	\$10,959
Re-paint Mansard/Portico Metal Roofing	\$20,700	7	2027	8	\$3,012	\$17,688	\$2,211
Stairwells & Railing, Repaint	\$22,400	14	2027	8	\$3,260	\$19,140	\$2,393
Total	\$362,500				\$52,752	\$309,748	\$95,007
INTERIOR REFURBISH							
Cardio Fitness Equipment, Replace	\$18,900	8	2020	1	\$2,750	\$16,150	\$16,150
Elliptical Fitness Equipment, Replace	\$5,300	8	2021	2	\$771	\$4,529	\$2,264
Kitchen Appliance Allowance	\$5,900	12	2024	5	\$859	\$5,041	\$1,008
Kitchen Stack, Cleanout	\$12,500	3	2019	1	\$1,819	\$10,681	\$10,681
Lobby, Renovate	\$50,000	18	2036	17	\$7,276	\$42,724	\$2,513
Mailboxes, Cluster, Replace	\$4,500	30	2048	29	\$655	\$3,845	\$133
Management Office, Refurbish	\$4,700	20	2027	8	\$684	\$4,016	\$502
Multi Gym, Replace	\$7,100	16	2028	9	\$1,033	\$6,067	\$674
Office Flooring, Carpet, Replace	\$4,700	8	2022	3	\$684	\$4,016	\$1,339
Windows & Doors, Replace	\$18,000	20	2033	14	\$2,619	\$15,381	\$1,099
Restrooms, Pool Renovate	\$10,500	24	2036	17	\$1,528	\$8,972	\$528
Social Room, Refurbish	\$71,200	22	2034	15	\$10,361	\$60,839	\$4,056
Treadmill, Replace	\$3,200	4	2019	1	\$466	\$2,734	\$2,734
Total	\$216,500				\$31,505	\$184,995	\$43,680

*The 12/31/18 balance amounts provided are based on a weighted proportional allocation of the estimated total ending balance.

Straight Line Reserve Schedule

Beginning Balance: **\$909,838**
 Fully Funded Reserves: **\$4,452,122**
 Percent Fully Funded as of 1/1/2019: **20%**

Description	Cost Estimate	Expected Life	Replacement Year	Remaining Life	12/31/18 Balance*	Unfunded Balance	2019 Contribution
MECHANICAL EQUIPMENT							
AC Circulating Pumps, Replace	\$10,900	14	2026	7	\$1,586	\$9,314	\$1,331
AC Cooling Tower, Replace	\$267,800	20	2021	2	\$38,971	\$228,829	\$114,415
AC Cooling Tower, Repair Allowance	\$6,000	10	2019	1	\$873	\$5,127	\$5,127
AC Equipment, Elevator Room, Replace	\$2,100	9	2022	3	\$306	\$1,794	\$598
AC Equipment, Exercise Room, Replace	\$8,000	14	2020	1	\$1,164	\$6,836	\$6,836
AC Equipment, Fitness Room, Replace	\$8,100	14	2020	1	\$1,179	\$6,921	\$6,921
AC Equipment, Lobby, Replace	\$13,300	14	2020	1	\$1,935	\$11,365	\$11,365
AC Equipment, Maintenance Shop	\$1,500	9	2020	1	\$218	\$1,282	\$1,282
AC Equipment, Office, Replace	\$7,600	14	2032	13	\$1,106	\$6,494	\$500
AC Equipment, Pump Room, Replace	\$4,500	14	2019	1	\$655	\$3,845	\$3,845
AC Equipment, Social Room, Replace	\$6,600	14	2020	1	\$960	\$5,640	\$5,640
Alarm Panel and Devices, Replace	\$23,700	20	2031	12	\$3,449	\$20,251	\$1,688
Backflow, Repair Allowance	\$13,000	10	2019	1	\$1,892	\$11,108	\$11,108
Boiler, Replace	\$33,200	20	2031	12	\$4,831	\$28,369	\$2,364
Domestic Water Pump, Replace	\$20,100	20	2028	9	\$2,925	\$17,175	\$1,908
Elevator Cabs, Refurbish	\$12,900	20	2028	9	\$1,877	\$11,023	\$1,225
Elevator Controls, Modernize	\$200,000	28	2027	8	\$29,104	\$170,896	\$21,362
Elevator Doors, Replace 50%	\$106,300	28	2046	27	\$15,469	\$90,831	\$3,364
Emergency Generator, Replace	\$101,000	36	2054	35	\$14,698	\$86,302	\$2,466
Expansion Tanks, Replace	\$4,500	10	2022	3	\$655	\$3,845	\$1,282
Fire Alarm Control Panel, Replace	\$38,900	10	2028	9	\$5,661	\$33,239	\$3,693
Fire Detection System, Upgrade	\$120,900	20	2020	1	\$17,594	\$103,306	\$103,306
Fire Hydrant, Replace 2 of 4	\$9,300	25	2037	18	\$1,353	\$7,947	\$441
Fire Hydrants, Replace 2 of 4	\$9,300	25	2041	22	\$1,353	\$7,947	\$361
Fire Pump, Replace	\$59,300	36	2025	6	\$8,629	\$50,671	\$8,445
Fire Speaker System, Upgrade	\$51,700	20	2033	14	\$7,523	\$44,177	\$3,155
Fire Sprinkler, Replacement Allowance	\$7,000	10	2019	1	\$1,019	\$5,981	\$5,981
Heat Exchanger, Replace	\$35,500	40	2029	10	\$5,166	\$30,334	\$3,033
Key Fobs, Replace	\$9,500	8	2026	7	\$1,382	\$8,118	\$1,160
Pool & Spa Heaters, Replace	\$5,100	10	2019	1	\$742	\$4,358	\$4,358
Pool Equipment, Allowance	\$5,300	5	2020	1	\$771	\$4,529	\$4,529
Recycling Containers, Replace	\$9,000	4	2019	1	\$1,310	\$7,690	\$7,690
Recycling System, Replace	\$83,000	20	2027	8	\$12,078	\$70,922	\$8,865
Tile Machine, Replace	\$8,200	12	2027	8	\$1,193	\$7,007	\$876
Variable Frequency Drive, Replace	\$9,900	14	2026	7	\$1,441	\$8,459	\$1,208
Ventilator Fans, North, Replace	\$3,100	18	2028	9	\$451	\$2,649	\$294
Total	\$1,316,100				\$191,521	\$1,124,579	\$362,022

BUILDING COMPONENTS

Cast Iron/Fire Pipes, Replace	\$50,000	27	2019	1	\$7,276	\$42,724	\$42,724
Drinking Fountains, Replace	\$2,400	14	2019	1	\$349	\$2,051	\$2,051
Front Entry Door Enterphone, Replace	\$4,500	14	2029	10	\$655	\$3,845	\$385
Front Entry Doors and Jambs	\$19,000	24	2034	15	\$2,765	\$16,235	\$1,082
Front Entry Shrubs	\$3,600	20	2032	13	\$524	\$3,076	\$237
Lanai Screen Repairs w/ Swingstage	\$38,600	24	2036	17	\$5,617	\$32,983	\$1,940
Light Fixtures, Replace	\$38,800	26	2020	1	\$5,646	\$33,154	\$33,154
Re-Screen Allowance	\$5,000	5	2019	1	\$728	\$4,272	\$4,272
Roll-Up Doors, Replace	\$7,500	20	2027	8	\$1,091	\$6,409	\$801
Screened Balconies & Railing, Replace	\$209,200	9	2023	4	\$30,443	\$178,757	\$44,689
Security Cameras & Equipment, Replace	\$4,800	8	2020	1	\$699	\$4,101	\$4,101
Tile Flooring, Replace	\$500,000	24	2020	1	\$72,761	\$427,239	\$427,239
Trash Chute Doors, Replace	\$16,700	20	2027	8	\$2,430	\$14,270	\$1,784
Trash Containers, Replace	\$3,800	10	2022	3	\$553	\$3,247	\$1,082
Total	\$903,900				\$131,537	\$772,363	\$65,541

*The 12/31/18 balance amounts provided are based on a weighted proportion of the estimated total ending balance.

RESERVE SCHEDULE**Straight Line Reserve Schedule**

Beginning Balance: **\$909,838**
 Fully Funded Reserves: **\$4,452,122**
 Percent Fully Funded as of 1/1/2019: **20%**

Description	Cost Estimate	Expected Life	Replacement Year	Remaining Life	12/31/18 Balance*	Unfunded Balance	2019 Contribution
GROUNDS COMPONENTS							
BBQ Grills (2), Replace	\$2,700	8	2020	1	\$393	\$2,307	\$2,307
Beach Deck & Railing, Replace	\$252,000	15	2030	11	\$36,671	\$215,329	\$19,575
Beach Deck Walkover: Dream Deck	\$67,300	20	2025	6	\$9,794	\$57,506	\$9,584
Beachside Gates, Replace	\$3,300	7	2025	6	\$480	\$2,820	\$470
Canopy Fabric, Replace	\$31,100	7	2020	1	\$4,526	\$26,574	\$26,574
Canopy Frames, Repair	\$5,600	21	2020	1	\$815	\$4,785	\$4,785
Dunewalk, Replace Decking & Rails	\$39,300	20	2035	16	\$5,719	\$33,581	\$2,099
Fencing, Chain Link, Replace	\$13,200	22	2022	3	\$1,921	\$11,279	\$3,760
Fencing, Pool, Replace	\$9,100	15	2033	14	\$1,324	\$7,776	\$555
Flag Pole, Replace	\$2,600	30	2030	11	\$378	\$2,222	\$202
Golf Cart, Replace	\$4,200	8	2024	5	\$611	\$3,589	\$718
Ice Machine, Replace	\$4,100	15	2030	11	\$597	\$3,503	\$318
Kneewall Repairs	\$44,000	20	2020	1	\$6,403	\$37,597	\$37,597
Landscape Renovation	\$100,000	15	2020	1	\$14,552	\$85,448	\$85,448
Light Poles, Replace	\$42,800	30	2030	11	\$6,228	\$36,572	\$3,325
Lobby Fountains, Pebblecoat	\$6,600	8	2020	1	\$960	\$5,640	\$5,640
Lobby Fountains, Replace Motors	\$3,800	8	2024	5	\$553	\$3,247	\$649
Pool & Spa, Resurface	\$18,000	10	2028	9	\$2,619	\$15,381	\$1,709
Pool & Spa, Retile	\$2,900	20	2026	7	\$422	\$2,478	\$354
Pool Deck Pavers, Replace	\$61,300	20	2020	1	\$8,920	\$52,380	\$52,380
Pool Equipment, Allowance	\$3,600	5	2023	4	\$524	\$3,076	\$769
Pool Furniture, Replace	\$5,000	8	2019	1	\$728	\$4,272	\$4,272
Pool House Slab Repairs	\$14,700	30	2045	26	\$2,139	\$12,561	\$483
Railing, Aluminum, Replace	\$9,700	28	2028	9	\$1,412	\$8,288	\$921
Railing, Sun Deck, Replace	\$4,600	20	2020	1	\$669	\$3,931	\$3,931
Tennis/Pickle Court, Resurface	\$8,000	5	2022	3	\$1,164	\$6,836	\$2,279
Total	\$759,500				\$110,524	\$648,976	\$270,704
MISC							
Annual Reserve Study	\$1,050	1	2019	1	\$153	\$897	\$897
Total	\$1,050				\$153	\$897	\$897
Grand Total	\$6,252,250				\$909,838	\$5,342,412	\$3,542,284

*The 12/31/18 balance amounts provided are based on a weighted proportional allocation of the estimated total ending balance.

Part 4: Cash Flow

This alternate funding plan utilizes a cash flow method with “pooled reserves,” in which all reserves are combined into a single general fund.

A 30-year cash flow analysis is then performed to determine the annual reserve contribution required to pay for all anticipated reserve expenditures and still maintain an adequate cash balance over time.

The cost and expected life for all components is the same as in the previous section. However, this analysis takes into account interest and inflation.

30-YEAR CASH FLOW PLAN

Number of Units: 117 Interest Rate: 1%
 Beginning Balance: \$ 909,838 Inflation Rate: 2%

No.	Year	Beginning Balance	Annual Assessment Increase	Monthly Contribution (Per Unit)	Total Annual Contribution (All Units)	Planned Special Assessment	Annual Expenditures	Interest Rate	Earned Interest	Ending Balance
1	2019	\$909,838	-	\$1,022.93	\$1,436,194	\$0	\$165,250	1.0%	\$21,808	\$2,202,590
2	2020	\$2,202,590	5.0%	\$1,074.08	\$1,508,003	\$0	\$3,611,565	1.0%	\$990	\$100,018
3	2021	\$100,018	5.0%	\$1,127.78	\$1,583,404	\$0	\$294,996	1.0%	\$13,884	\$1,402,310
4	2022	\$1,402,310	-70.0%	\$338.33	\$475,021	\$0	\$52,841	1.0%	\$18,245	\$1,842,735
5	2023	\$1,842,735	0.0%	\$338.33	\$475,021	\$0	\$561,978	1.0%	\$17,558	\$1,773,336
6	2024	\$1,773,336	0.0%	\$338.33	\$475,021	\$0	\$62,645	1.0%	\$21,857	\$2,207,569
7	2025	\$2,207,569	0.0%	\$338.33	\$475,021	\$0	\$215,992	1.0%	\$24,666	\$2,491,264
8	2026	\$2,491,264	0.0%	\$338.33	\$475,021	\$0	\$39,045	1.0%	\$29,272	\$2,956,513
9	2027	\$2,956,513	0.0%	\$338.33	\$475,021	\$0	\$662,070	1.0%	\$27,695	\$2,797,158
10	2028	\$2,797,158	0.0%	\$338.33	\$475,021	\$0	\$197,001	1.0%	\$30,752	\$3,105,930
11	2029	\$3,105,930	0.0%	\$338.33	\$475,021	\$0	\$150,540	1.0%	\$34,304	\$3,464,715
12	2030	\$3,464,715	0.0%	\$338.33	\$475,021	\$0	\$770,979	1.0%	\$31,688	\$3,200,445
13	2031	\$3,200,445	0.0%	\$338.33	\$475,021	\$0	\$116,870	1.0%	\$35,586	\$3,594,182
14	2032	\$3,594,182	0.0%	\$338.33	\$475,021	\$0	\$320,103	1.0%	\$37,491	\$3,786,591
15	2033	\$3,786,591	0.0%	\$338.33	\$475,021	\$0	\$127,808	1.0%	\$41,338	\$4,175,142
16	2034	\$4,175,142	0.0%	\$338.33	\$475,021	\$0	\$336,375	1.0%	\$43,138	\$4,356,926
17	2035	\$4,356,926	0.0%	\$338.33	\$475,021	\$0	\$2,558,622	1.0%	\$22,733	\$2,296,059
18	2036	\$2,296,059	0.0%	\$338.33	\$475,021	\$0	\$195,707	1.0%	\$25,754	\$2,601,126
19	2037	\$2,601,126	0.0%	\$338.33	\$475,021	\$0	\$449,412	1.0%	\$26,267	\$2,653,003
20	2038	\$2,653,003	0.0%	\$338.33	\$475,021	\$0	\$93,495	1.0%	\$30,345	\$3,064,874
21	2039	\$3,064,874	0.0%	\$338.33	\$475,021	\$0	\$143,290	1.0%	\$33,966	\$3,430,571
22	2040	\$3,430,571	0.0%	\$338.33	\$475,021	\$0	\$454,613	1.0%	\$34,510	\$3,485,489
23	2041	\$3,485,489	0.0%	\$338.33	\$475,021	\$0	\$860,184	1.0%	\$31,003	\$3,131,329
24	2042	\$3,131,329	0.0%	\$338.33	\$475,021	\$0	\$51,173	1.0%	\$35,552	\$3,590,729
25	2043	\$3,590,729	0.0%	\$338.33	\$475,021	\$0	\$71,558	1.0%	\$39,942	\$4,034,134
26	2044	\$4,034,134	0.0%	\$338.33	\$475,021	\$0	\$1,324,725	1.0%	\$31,844	\$3,216,275
27	2045	\$3,216,275	0.0%	\$338.33	\$475,021	\$0	\$598,652	1.0%	\$30,926	\$3,123,570
28	2046	\$3,123,570	0.0%	\$338.33	\$475,021	\$0	\$354,585	1.0%	\$32,440	\$3,276,446
29	2047	\$3,276,446	0.0%	\$338.33	\$475,021	\$0	\$422,838	1.0%	\$33,286	\$3,361,916
30	2048	\$3,361,916	0.0%	\$338.33	\$475,021	\$0	\$372,169	1.0%	\$34,648	\$3,499,415

Year-By-Year Expenditures

YEAR-BY-YEAR EXPENDITURES

Replacement Year	2019	Current Cost	Future Cost
Paving, Bomanite Reseal		\$32,000	\$32,000
Seal Coat Blacktop areas		\$9,500	\$9,500
Kitchen Stack, Cleanout		\$12,500	\$12,500
Treadmill, Replace		\$3,200	\$3,200
AC Cooling Tower, Repair Allowance		\$6,000	\$6,000
AC Equipment, Pump Room, Replace		\$4,500	\$4,500
Backflow, Repair Allowance		\$13,000	\$13,000
Fire Sprinkler, Replacement Allowance		\$7,000	\$7,000
Pool & Spa Heaters, Replace		\$5,100	\$5,100
Recycling Containers, Replace		\$9,000	\$9,000
Cast Iron/Fire Pipes, Replace		\$50,000	\$50,000
Drinking Fountains, Replace		\$2,400	\$2,400
Re-Screen Allowance		\$5,000	\$5,000
Pool Furniture, Replace		\$5,000	\$5,000
Annual Reserve Study		\$1,050	\$1,050
Total Expenditures			<u>\$165,250</u>

YEAR-BY-YEAR EXPENDITURES

Replacement Year	2020	Current Cost	Future Cost
Annual Reserve Study		\$1,050	\$1,071
Roofing, Mansard, Reroof		\$784,600	\$800,292
Roofing, North Garage, Reroof		\$244,900	\$249,798
Roofing, South Garage, Reroof		\$233,300	\$237,966
Roofing, Tower, Replace		\$1,253,200	\$1,278,264
Tiki Huts, Bicycle Storage, Re-thatch		\$5,000	\$5,100
Tiki Huts, Pool, Re-thatch		\$2,000	\$2,040
North & South Garage, Repaint & Repair		\$31,200	\$31,824
Painting, Parking Lot Light Poles		\$3,400	\$3,468
Cardio Fitness Equipment, Replace		\$18,900	\$19,278
AC Equipment, Exercise Room, Replace		\$8,000	\$8,160
AC Equipment, Fitness Room, Replace		\$8,100	\$8,262
AC Equipment, Lobby, Replace		\$13,300	\$13,566
AC Equipment, Maintenance Shop		\$1,500	\$1,530
AC Equipment, Social Room, Replace		\$6,600	\$6,732
Fire Detection System, Upgrade		\$120,900	\$123,318
Pool Equipment, Allowance		\$5,300	\$5,406
Light Fixtures, Replace		\$38,800	\$39,576
Security Cameras & Equipment, Replace		\$4,800	\$4,896
Tile Flooring, Replace		\$500,000	\$510,000
BBQ Grills (2), Replace		\$2,700	\$2,754
Canopy Fabric, Replace		\$31,100	\$31,722
Canopy Frames, Repair		\$5,600	\$5,712
Kneewall Repairs		\$44,000	\$44,880
Landscape Renovation		\$100,000	\$102,000
Lobby Fountains, Pebblecoat		\$6,600	\$6,732
Pool Deck Pavers, Replace		\$61,300	\$62,526
Railing, Sun Deck, Replace		\$4,600	\$4,692
Total Expenditures			<u>\$3,611,565</u>

Replacement Year	2021	Current Cost	Future Cost
Seal Coat Blacktop areas		\$9,500	\$9,880
Annual Reserve Study		\$1,050	\$1,092
Elliptical Fitness Equipment, Replace		\$5,300	\$5,512
AC Cooling Tower, Replace		\$267,800	<u>\$278,512</u>
Total Expenditures			<u>\$294,996</u>

YEAR-BY-YEAR EXPENDITURES

Replacement Year	2022	Current Cost	Future Cost
Kitchen Stack, Cleanout		\$12,500	\$13,250
Annual Reserve Study		\$1,050	\$1,113
Office Flooring, Carpet, Replace		\$4,700	\$4,982
AC Equipment, Elevator Room, Replace		\$2,100	\$2,226
Expansion Tanks, Replace		\$4,500	\$4,770
Trash Containers, Replace		\$3,800	\$4,028
Fencing, Chain Link, Replace		\$13,200	\$13,992
Tennis/Pickle Court, Resurface		\$8,000	\$8,480
Total Expenditures			<u>\$52,841</u>

Replacement Year	2023	Current Cost	Future Cost
Seal Coat Blacktop areas		\$9,500	\$10,260
Treadmill, Replace		\$3,200	\$3,456
Recycling Containers, Replace		\$9,000	\$9,720
Annual Reserve Study		\$1,050	\$1,134
Painting, Exterior, Tower		\$233,500	\$252,180
Painting, Interior Common Areas		\$51,300	\$55,404
Screened Balconies & Railing, Replace		\$209,200	\$225,936
Pool Equipment, Allowance		\$3,600	\$3,888
Total Expenditures			<u>\$561,978</u>

Replacement Year	2024	Current Cost	Future Cost
Paving, Bomanite Reseal		\$32,000	\$35,200
Re-Screen Allowance		\$5,000	\$5,500
Annual Reserve Study		\$1,050	\$1,155
Tiki Huts, Bicycle Storage, Re-thatch		\$5,000	\$5,500
Kitchen Appliance Allowance		\$5,900	\$6,490
Golf Cart, Replace		\$4,200	\$4,620
Lobby Fountains, Replace Motors		\$3,800	\$4,180
Total Expenditures			<u>\$62,645</u>

YEAR-BY-YEAR EXPENDITURES

Replacement Year	2025	Current Cost	Future Cost
Seal Coat Blacktop areas		\$9,500	\$10,640
Kitchen Stack, Cleanout		\$12,500	\$14,000
Annual Reserve Study		\$1,050	\$1,176
North & South Garage, Repaint & Repair		\$31,200	\$34,944
Painting, Parking Lot Light Poles		\$3,400	\$3,808
Pool Equipment, Allowance		\$5,300	\$5,936
Fire Pump, Replace		\$59,300	\$66,416
Beachside Gates, Replace		\$3,300	\$3,696
Beach Deck Walkover: Dream Deck		\$67,300	<u>\$75,376</u>
Total Expenditures			\$215,992
Replacement Year	2026	Current Cost	Future Cost
Annual Reserve Study		\$1,050	\$1,197
AC Circulating Pumps, Replace		\$10,900	\$12,426
Key Fobs, Replace		\$9,500	\$10,830
Variable Frequency Drive, Replace		\$9,900	\$11,286
Pool & Spa, Retile		\$2,900	<u>\$3,306</u>
Total Expenditures			\$39,045
Replacement Year	2027	Current Cost	Future Cost
Seal Coat Blacktop areas		\$9,500	\$11,020
Treadmill, Replace		\$3,200	\$3,712
Recycling Containers, Replace		\$9,000	\$10,440
Pool Furniture, Replace		\$5,000	\$5,800
Annual Reserve Study		\$1,050	\$1,218
Re-paint Mansard/Portico Metal Roofing		\$20,700	\$24,012
Canopy Fabric, Replace		\$31,100	\$36,076
Tennis/Pickle Court, Resurface		\$8,000	\$9,280
Paving, Asphalt Overlay		\$120,000	\$139,200
Re-paint Mansard/Portico Metal Roofing		\$20,700	\$24,012
Stairwells & Railing, Repaint		\$22,400	\$25,984
Management Office, Refurbish		\$4,700	\$5,452
Elevator Controls, Modernize		\$200,000	\$232,000
Recycling System, Replace		\$83,000	\$96,280
Tile Machine, Replace		\$8,200	\$9,512
Roll-Up Doors, Replace		\$7,500	\$8,700
Trash Chute Doors, Replace		\$16,700	<u>\$19,372</u>
Total Expenditures			\$662,070

YEAR-BY-YEAR EXPENDITURES

Replacement Year	2028	Current Cost	Future Cost
Kitchen Stack, Cleanout		\$12,500	\$14,750
Annual Reserve Study		\$1,050	\$1,239
Tiki Huts, Bicycle Storage, Re-thatch		\$5,000	\$5,900
Tiki Huts, Pool, Re-thatch		\$2,000	\$2,360
Cardio Fitness Equipment, Replace		\$18,900	\$22,302
Security Cameras & Equipment, Replace		\$4,800	\$5,664
BBQ Grills (2), Replace		\$2,700	\$3,186
Lobby Fountains, Pebblecoat		\$6,600	\$7,788
Pool Equipment, Allowance		\$3,600	\$4,248
Multi Gym, Replace		\$7,100	\$8,378
Domestic Water Pump, Replace		\$20,100	\$23,718
Elevator Cabs, Refurbish		\$12,900	\$15,222
Fire Alarm Control Panel, Replace		\$38,900	\$45,902
Ventilator Fans, North, Replace		\$3,100	\$3,658
Pool & Spa, Resurface		\$18,000	\$21,240
Railing, Aluminum, Replace		\$9,700	\$11,446
Total Expenditures			<u>\$197,001</u>

Replacement Year	2029	Current Cost	Future Cost
Paving, Bomanite Reseal		\$32,000	\$38,400
Seal Coat Blacktop areas		\$9,500	\$11,400
AC Cooling Tower, Repair Allowance		\$6,000	\$7,200
Backflow, Repair Allowance		\$13,000	\$15,600
Fire Sprinkler, Replacement Allowance		\$7,000	\$8,400
Pool & Spa Heaters, Replace		\$5,100	\$6,120
Re-Screen Allowance		\$5,000	\$6,000
Annual Reserve Study		\$1,050	\$1,260
AC Equipment, Maintenance Shop		\$1,500	\$1,800
Elliptical Fitness Equipment, Replace		\$5,300	\$6,360
Heat Exchanger, Replace		\$35,500	\$42,600
Front Entry Door Enterphone, Replace		\$4,500	\$5,400
Total Expenditures			<u>\$150,540</u>

YEAR-BY-YEAR EXPENDITURES

Replacement Year	2030	Current Cost	Future Cost
Annual Reserve Study		\$1,050	\$1,281
North & South Garage, Repaint & Repair		\$31,200	\$38,064
Painting, Parking Lot Light Poles		\$3,400	\$4,148
Pool Equipment, Allowance		\$5,300	\$6,466
Office Flooring, Carpet, Replace		\$4,700	\$5,734
Painting, Exterior, Tower		\$233,500	\$284,870
Painting, Interior Common Areas		\$51,300	\$62,586
Flag Pole, Replace		\$2,600	\$3,172
Light Poles, Replace		\$42,800	\$52,216
Beach Deck & Railing, Replace		\$252,000	\$307,440
Ice Machine, Replace		\$4,100	\$5,002
Total Expenditures			<u>\$770,979</u>

Replacement Year	2031	Current Cost	Future Cost
Seal Coat Blacktop areas		\$9,500	\$11,780
Kitchen Stack, Cleanout		\$12,500	\$15,500
Treadmill, Replace		\$3,200	\$3,968
Recycling Containers, Replace		\$9,000	\$11,160
Annual Reserve Study		\$1,050	\$1,302
AC Equipment, Elevator Room, Replace		\$2,100	\$2,604
Alarm Panel and Devices, Replace		\$23,700	\$29,388
Boiler, Replace		\$33,200	\$41,168
Total Expenditures			<u>\$116,870</u>

Replacement Year	2032	Current Cost	Future Cost
Annual Reserve Study		\$1,050	\$1,323
Tiki Huts, Bicycle Storage, Re-thatch		\$5,000	\$6,300
Expansion Tanks, Replace		\$4,500	\$5,670
Trash Containers, Replace		\$3,800	\$4,788
Tennis/Pickle Court, Resurface		\$8,000	\$10,080
Screened Balconies & Railing, Replace		\$209,200	\$263,592
Golf Cart, Replace		\$4,200	\$5,292
Lobby Fountains, Replace Motors		\$3,800	\$4,788
Beachside Gates, Replace		\$3,300	\$4,158
Front Entry Shrubs		\$3,600	\$4,536
AC Equipment, Office, Replace		\$7,600	\$9,576
Total Expenditures			<u>\$320,103</u>

YEAR-BY-YEAR EXPENDITURES

Replacement Year	2033	Current Cost	Future Cost
Seal Coat Blacktop areas		\$9,500	\$12,160
AC Equipment, Pump Room, Replace		\$4,500	\$5,760
Drinking Fountains, Replace		\$2,400	\$3,072
Annual Reserve Study		\$1,050	\$1,344
Pool Equipment, Allowance		\$3,600	\$4,608
Windows & Doors, Replace		\$18,000	\$23,040
Fire Speaker System, Upgrade		\$51,700	\$66,176
Fencing, Pool, Replace		\$9,100	\$11,648
Total Expenditures			<u>\$127,808</u>

Replacement Year	2034	Current Cost	Future Cost
Paving, Bomanite Reseal		\$32,000	\$41,600
Kitchen Stack, Cleanout		\$12,500	\$16,250
Re-Screen Allowance		\$5,000	\$6,500
Annual Reserve Study		\$1,050	\$1,365
Re-paint Mansard/Portico Metal Roofing		\$20,700	\$26,910
AC Equipment, Exercise Room, Replace		\$8,000	\$10,400
AC Equipment, Fitness Room, Replace		\$8,100	\$10,530
AC Equipment, Lobby, Replace		\$13,300	\$17,290
AC Equipment, Social Room, Replace		\$6,600	\$8,580
Canopy Fabric, Replace		\$31,100	\$40,430
Key Fobs, Replace		\$9,500	\$12,350
Re-paint Mansard/Portico Metal Roofing		\$20,700	\$26,910
Social Room, Refurbish		\$71,200	\$92,560
Front Entry Doors and Jambs		\$19,000	\$24,700
Total Expenditures			<u>\$336,375</u>

YEAR-BY-YEAR EXPENDITURES

Replacement Year	2035	Current Cost	Future Cost
Seal Coat Blacktop areas		\$9,500	\$12,540
Treadmill, Replace		\$3,200	\$4,224
Recycling Containers, Replace		\$9,000	\$11,880
Pool Furniture, Replace		\$5,000	\$6,600
Annual Reserve Study		\$1,050	\$1,386
Roofing, North Garage, Reroof		\$244,900	\$323,268
Roofing, South Garage, Reroof		\$233,300	\$307,956
Roofing, Tower, Replace		\$1,253,200	\$1,654,224
North & South Garage, Repaint & Repair		\$31,200	\$41,184
Painting, Parking Lot Light Poles		\$3,400	\$4,488
Pool Equipment, Allowance		\$5,300	\$6,996
Landscape Renovation		\$100,000	\$132,000
Dunewalk, Replace Decking & Rails		\$39,300	\$51,876
Total Expenditures			<u>\$2,558,622</u>

Replacement Year	2036	Current Cost	Future Cost
Annual Reserve Study		\$1,050	\$1,407
Tiki Huts, Bicycle Storage, Re-thatch		\$5,000	\$6,700
Tiki Huts, Pool, Re-thatch		\$2,000	\$2,680
Cardio Fitness Equipment, Replace		\$18,900	\$25,326
Security Cameras & Equipment, Replace		\$4,800	\$6,432
BBQ Grills (2), Replace		\$2,700	\$3,618
Lobby Fountains, Pebblecoat		\$6,600	\$8,844
Kitchen Appliance Allowance		\$5,900	\$7,906
Lobby, Renovate		\$50,000	\$67,000
Restrooms, Pool Renovate		\$10,500	\$14,070
Lanai Screen Repairs w/ Swingstage		\$38,600	\$51,724
Total Expenditures			<u>\$195,707</u>

Replacement Year	2037	Current Cost	Future Cost
Seal Coat Blacktop areas		\$9,500	\$12,920
Kitchen Stack, Cleanout		\$12,500	\$17,000
Annual Reserve Study		\$1,050	\$1,428
Elliptical Fitness Equipment, Replace		\$5,300	\$7,208
Tennis/Pickle Court, Resurface		\$8,000	\$10,880
Painting, Exterior, Tower		\$233,500	\$317,560
Painting, Interior Common Areas		\$51,300	\$69,768
Fire Hydrant, Replace 2 of 4		\$9,300	\$12,648
Total Expenditures			<u>\$449,412</u>

YEAR-BY-YEAR EXPENDITURES

Replacement Year	2038	Current Cost	Future Cost
Annual Reserve Study		\$1,050	\$1,449
AC Equipment, Maintenance Shop		\$1,500	\$2,070
Office Flooring, Carpet, Replace		\$4,700	\$6,486
Pool Equipment, Allowance		\$3,600	\$4,968
Fire Alarm Control Panel, Replace		\$38,900	\$53,682
Pool & Spa, Resurface		\$18,000	\$24,840
Total Expenditures			<u>\$93,495</u>
Replacement Year	2039	Current Cost	Future Cost
Paving, Bomanite Reseal		\$32,000	\$44,800
Seal Coat Blacktop areas		\$9,500	\$13,300
Treadmill, Replace		\$3,200	\$4,480
AC Cooling Tower, Repair Allowance		\$6,000	\$8,400
Backflow, Repair Allowance		\$13,000	\$18,200
Fire Sprinkler, Replacement Allowance		\$7,000	\$9,800
Pool & Spa Heaters, Replace		\$5,100	\$7,140
Recycling Containers, Replace		\$9,000	\$12,600
Re-Screen Allowance		\$5,000	\$7,000
Annual Reserve Study		\$1,050	\$1,470
Beachside Gates, Replace		\$3,300	\$4,620
Tile Machine, Replace		\$8,200	\$11,480
Total Expenditures			<u>\$143,290</u>
Replacement Year	2040	Current Cost	Future Cost
Kitchen Stack, Cleanout		\$12,500	\$17,750
Annual Reserve Study		\$1,050	\$1,491
Tiki Huts, Bicycle Storage, Re-thatch		\$5,000	\$7,100
North & South Garage, Repaint & Repair		\$31,200	\$44,304
Painting, Parking Lot Light Poles		\$3,400	\$4,828
Fire Detection System, Upgrade		\$120,900	\$171,678
Pool Equipment, Allowance		\$5,300	\$7,526
Kneewall Repairs		\$44,000	\$62,480
Pool Deck Pavers, Replace		\$61,300	\$87,046
Railing, Sun Deck, Replace		\$4,600	\$6,532
AC Equipment, Elevator Room, Replace		\$2,100	\$2,982
Golf Cart, Replace		\$4,200	\$5,964
Lobby Fountains, Replace Motors		\$3,800	\$5,396
AC Circulating Pumps, Replace		\$10,900	\$15,478
Variable Frequency Drive, Replace		\$9,900	\$14,058
Total Expenditures			<u>\$454,613</u>

YEAR-BY-YEAR EXPENDITURES

Replacement Year	2041	Current Cost	Future Cost
Seal Coat Blacktop areas		\$9,500	\$13,680
Annual Reserve Study		\$1,050	\$1,512
Re-paint Mansard/Portico Metal Roofing		\$20,700	\$29,808
Canopy Fabric, Replace		\$31,100	\$44,784
Canopy Frames, Repair		\$5,600	\$8,064
AC Cooling Tower, Replace		\$267,800	\$385,632
Screened Balconies & Railing, Replace		\$209,200	\$301,248
Re-paint Mansard/Portico Metal Roofing		\$20,700	\$29,808
Stairwells & Railing, Repaint		\$22,400	\$32,256
Fire Hydrants, Replace 2 of 4		\$9,300	\$13,392
Total Expenditures			<u>\$860,184</u>

Replacement Year	2042	Current Cost	Future Cost
Annual Reserve Study		\$1,050	\$1,533
Expansion Tanks, Replace		\$4,500	\$6,570
Trash Containers, Replace		\$3,800	\$5,548
Tennis/Pickle Court, Resurface		\$8,000	\$11,680
Key Fobs, Replace		\$9,500	\$13,870
Brick Pavers, South Garage, Replace		\$8,200	\$11,972
Total Expenditures			<u>\$51,173</u>

Replacement Year	2043	Current Cost	Future Cost
Seal Coat Blacktop areas		\$9,500	\$14,060
Kitchen Stack, Cleanout		\$12,500	\$18,500
Treadmill, Replace		\$3,200	\$4,736
Recycling Containers, Replace		\$9,000	\$13,320
Pool Furniture, Replace		\$5,000	\$7,400
Annual Reserve Study		\$1,050	\$1,554
Pool Equipment, Allowance		\$3,600	\$5,328
Front Entry Door Enterphone, Replace		\$4,500	\$6,660
Total Expenditures			<u>\$71,558</u>

YEAR-BY-YEAR EXPENDITURES

Replacement Year	2044	Current Cost	Future Cost
Paving, Bomanite Reseal		\$32,000	\$48,000
Re-Screen Allowance		\$5,000	\$7,500
Annual Reserve Study		\$1,050	\$1,575
Tiki Huts, Bicycle Storage, Re-thatch		\$5,000	\$7,500
Tiki Huts, Pool, Re-thatch		\$2,000	\$3,000
Cardio Fitness Equipment, Replace		\$18,900	\$28,350
Security Cameras & Equipment, Replace		\$4,800	\$7,200
Tile Flooring, Replace		\$500,000	\$750,000
BBQ Grills (2), Replace		\$2,700	\$4,050
Lobby Fountains, Pebblecoat		\$6,600	\$9,900
Fencing, Chain Link, Replace		\$13,200	\$19,800
Painting, Exterior, Tower		\$233,500	\$350,250
Painting, Interior Common Areas		\$51,300	\$76,950
Multi Gym, Replace		\$7,100	\$10,650
Total Expenditures			<u>\$1,324,725</u>

Replacement Year	2045	Current Cost	Future Cost
Seal Coat Blacktop areas		\$9,500	\$14,440
Annual Reserve Study		\$1,050	\$1,596
North & South Garage, Repaint & Repair		\$31,200	\$47,424
Painting, Parking Lot Light Poles		\$3,400	\$5,168
Pool Equipment, Allowance		\$5,300	\$8,056
Elliptical Fitness Equipment, Replace		\$5,300	\$8,056
Beach Deck Walkover: Dream Deck		\$67,300	\$102,296
Pool House Slab Repairs		\$14,700	\$22,344
Beach Deck & Railing, Replace		\$252,000	\$383,040
Ice Machine, Replace		\$4,100	\$6,232
Total Expenditures			<u>\$598,652</u>

Replacement Year	2046	Current Cost	Future Cost
Kitchen Stack, Cleanout		\$12,500	\$19,250
Cast Iron/Fire Pipes, Replace		\$50,000	\$77,000
Annual Reserve Study		\$1,050	\$1,617
Light Fixtures, Replace		\$38,800	\$59,752
Office Flooring, Carpet, Replace		\$4,700	\$7,238
Beachside Gates, Replace		\$3,300	\$5,082
Pool & Spa, Retile		\$2,900	\$4,466
Ventilator Fans, North, Replace		\$3,100	\$4,774
Elevator Doors, Replace 50%		\$106,300	\$163,702
AC Equipment, Office, Replace		\$7,600	\$11,704
Total Expenditures			<u>\$354,585</u>



YEAR-BY-YEAR EXPENDITURES

Replacement Year	2047	Current Cost	Future Cost
Seal Coat Blacktop areas		\$9,500	\$14,820
Treadmill, Replace		\$3,200	\$4,992
AC Equipment, Pump Room, Replace		\$4,500	\$7,020
Recycling Containers, Replace		\$9,000	\$14,040
Drinking Fountains, Replace		\$2,400	\$3,744
Annual Reserve Study		\$1,050	\$1,638
AC Equipment, Maintenance Shop		\$1,500	\$2,340
Tennis/Pickle Court, Resurface		\$8,000	\$12,480
Paving, Asphalt Overlay		\$120,000	\$187,200
Management Office, Refurbish		\$4,700	\$7,332
Recycling System, Replace		\$83,000	\$129,480
Roll-Up Doors, Replace		\$7,500	\$11,700
Trash Chute Doors, Replace		\$16,700	\$26,052
Total Expenditures			<u>\$422,838</u>

Replacement Year	2048	Current Cost	Future Cost
Annual Reserve Study		\$1,050	\$1,659
Tiki Huts, Bicycle Storage, Re-thatch		\$5,000	\$7,900
Re-paint Mansard/Portico Metal Roofing		\$20,700	\$32,706
AC Equipment, Exercise Room, Replace		\$8,000	\$12,640
AC Equipment, Fitness Room, Replace		\$8,100	\$12,798
AC Equipment, Lobby, Replace		\$13,300	\$21,014
AC Equipment, Social Room, Replace		\$6,600	\$10,428
Canopy Fabric, Replace		\$31,100	\$49,138
Pool Equipment, Allowance		\$3,600	\$5,688
Kitchen Appliance Allowance		\$5,900	\$9,322
Golf Cart, Replace		\$4,200	\$6,636
Lobby Fountains, Replace Motors		\$3,800	\$6,004
Re-paint Mansard/Portico Metal Roofing		\$20,700	\$32,706
Mailboxes, Cluster, Replace		\$4,500	\$7,110
Domestic Water Pump, Replace		\$20,100	\$31,758
Elevator Cabs, Refurbish		\$12,900	\$20,382
Fire Alarm Control Panel, Replace		\$38,900	\$61,462
Pool & Spa, Resurface		\$18,000	\$28,440
Fencing, Pool, Replace		\$9,100	\$14,378
Total Expenditures			<u>\$372,169</u>

Part 5: Charts & Graphs

The following charts and graphs are intended to provide a better understanding of the numbers contained in this report.

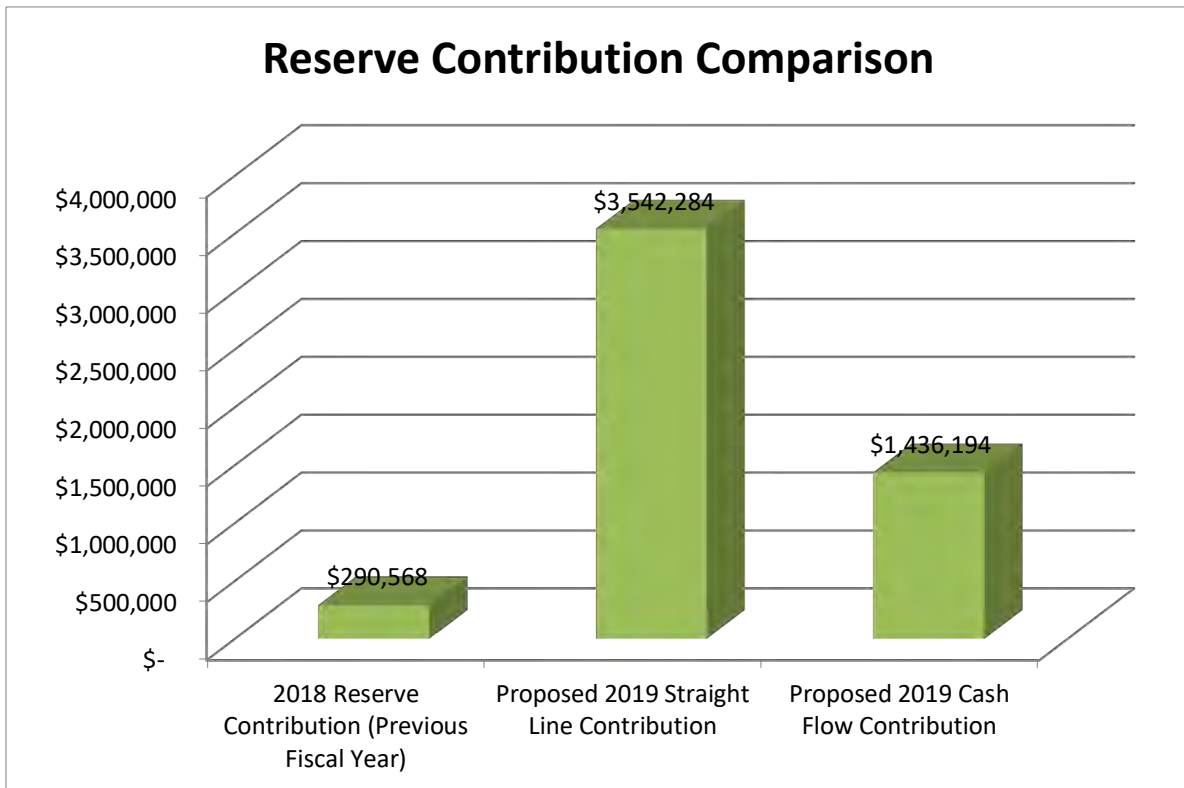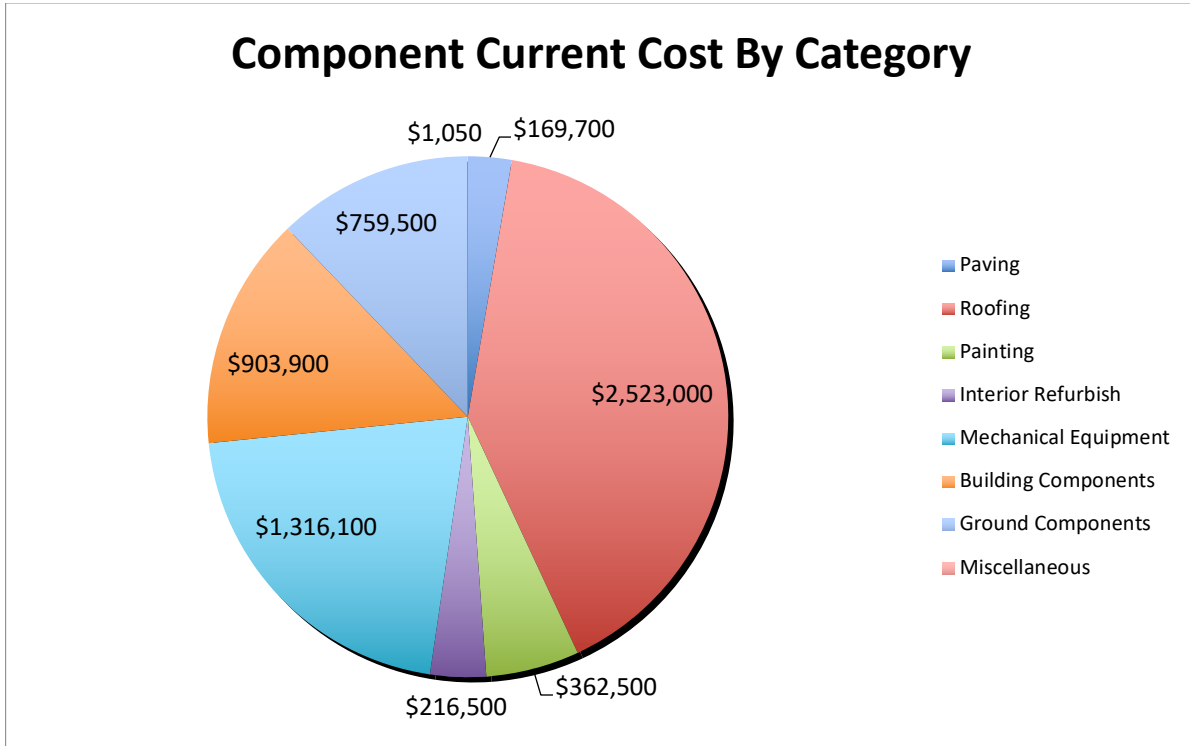

Part 6: Appendix

Florida Statutory Reserve Requirements

FLORIDA STATUTES

The following an excerpt from Florida Statutes Chapter 718 concerning reserve budget requirements for condominium associations. This is provided for reference only and is not intended as legal advice.

...(f) Annual budget.

1. The proposed annual budget of estimated revenues and expenses shall be detailed and shall show the amounts budgeted by accounts and expense classifications, including, if applicable, but not limited to, those expenses listed in s. 718.504(21). A multicondominium association shall adopt a separate budget of common expenses for each condominium the association operates and shall adopt a separate budget of common expenses for the association. In addition, if the association maintains limited common elements with the cost to be shared only by those entitled to use the limited common elements as provided for in s. 718.113 (1), the budget or a schedule attached thereto shall show amounts budgeted therefore. If, after turnover of control of the association to the unit owners, any of the expenses listed in s. 718.504 (21) are not applicable, they need not be listed.

2. In addition to annual operating expenses, the budget shall include reserve accounts for capital expenditures and deferred maintenance. These accounts shall include, but are not limited to, roof replacement, building painting, and pavement resurfacing, regardless of the amount of deferred maintenance expense or replacement cost, and for any other item for which the deferred maintenance expense or replacement cost exceeds \$10,000. The amount to be reserved shall be computed by means of a formula which is based upon estimated remaining useful life and estimated replacement cost or deferred maintenance expense of each reserve item. The association may adjust replacement reserve assessments annually to take into account any changes in estimates or extension of the useful life of a reserve item caused by deferred maintenance. This subsection does not apply to an adopted budget in which the members of an association have determined, by a majority vote at a duly called meeting of the association, to provide no reserves or less reserves than required by this subsection. However, prior to turnover of control of an association by a developer to unit owners other than a developer pursuant to s. 718.301, the developer may vote to waive the reserves or reduce the funding of reserves for the first 2 fiscal years of the association's operation, beginning with the fiscal year in which the initial declaration is recorded, after which time reserves may be waived or reduced only upon the vote of a majority of all nondeveloper voting interests voting in person or by limited proxy at a duly called meeting of the association. If a meeting of the unit owners has been called to determine whether to waive or reduce the funding of reserves, and no such result is achieved or a quorum is not attained, the reserves as included in the budget shall go into effect. After the turnover, the developer may vote its voting interest to waive or reduce the funding of reserves.

3. Reserve funds and any interest accruing thereon shall remain in the reserve account or accounts, and shall be used only for authorized reserve expenditures unless their use for other purposes is approved in advance by a majority vote at a duly called meeting of the association. Prior to turnover of control of an association by a developer to unit owners other than the developer pursuant to s. 718.301, the developer-controlled association shall not vote to use reserves for purposes other than that for which they were intended without the approval of a majority of all nondeveloper voting interests, voting in person or by limited proxy at a duly called meeting of the association.

FLORIDA ADMINISTRATIVE CODE

The following an excerpt from the Florida Administrative Code Rule 61B concerning reserve budget requirements for condominium associations. This is provided for reference only and is not intended as legal advice.

61B-22.001 Definitions.

For the purposes of this chapter the following definitions shall apply:

(1) "Accounting records" include all of the books and records identified in Section 718.111(12)(a)11., Florida Statutes, and any other records that identify, measure, record, or communicate financial information whether the records are maintained electronically or otherwise, including, all payroll and personnel records of the association, all invoices for purchases made by the association, and all invoices for services provided to the association.

(2) "Capital expenditure" means any expenditure of funds for:

(a) The purchase of an asset whose useful life is greater than one year in length;

(b) The replacement of an asset whose useful life is greater than one year in length; or

(c) The addition to an asset that extends the useful life of the previously existing asset for a period greater than one year in length.

(3) "Deferred maintenance" means any maintenance or repair that:

(a) Will be performed less frequently than yearly; and

(b) Will result in maintaining the useful life of an asset.

(4) "Funds" means money and negotiable instruments including, for example, cash, checks, notes, and securities.

(5) "Reserves" means any funds, other than operating funds, that are restricted for deferred maintenance and capital expenditures, including the items required by Section 718.112(2)(f)2., Florida Statutes, and any other funds restricted as to use by the condominium documents or the condominium association. Funds that are not restricted as to use by Section 718.112(2)(f), Florida Statutes, the condominium documents or by the association shall not be considered reserves within the meaning of this rule.

(6) "Turnover" means transfer of association control from developers to non-developer unit owners pursuant to Section 718.301, Florida Statutes.

61B-22.003 Budgets.

(1) Required elements for estimated operating budgets. The budget for each association shall:

(d) Include all estimated common expenses or expenditures of the association including the categories set forth in Section 718.504(21)(c), Florida Statutes. Reserves for capital expenditures and deferred maintenance required by Section 718.112(2)(f), Florida Statutes, must be included in the proposed annual budget and shall not be waived or reduced prior to the mailing to unit owners of a proposed annual budget. If the estimated common expense for any category set forth in the statute is not applicable, the category shall be listed followed by an indication that the expense is not applicable;

FLORIDA ADMINISTRATIVE CODE

The following an excerpt from the Florida Administrative Code Rule 61B concerning reserve budget requirements for condominium associations. This is provided for reference only and is not intended as legal advice.

(e) Unless the association maintains a pooled account for reserves required by Section 718.112(2)(f)2., Florida Statutes, the association shall include a schedule stating each reserve account for capital expenditures and deferred maintenance as a separate line item with the following minimum disclosures:

1. The total estimated useful life of the asset;
2. The estimated remaining useful life of the asset;
3. The estimated replacement cost or deferred maintenance expense of the asset;
4. The estimated fund balance as of the beginning of the period for which the budget will be in effect; and

5. The developer's total funding obligation, when all units are sold, for each converter reserve account established pursuant to Section 718.618, Florida Statutes, if applicable.

(f) If the association maintains a pooled account for reserves required by Section 718.112(2)(f)2., Florida Statutes, the association shall include a separate schedule of any pooled reserves with the following minimum disclosures:

1. The total estimated useful life of each asset within the pooled analysis;
2. The estimated remaining useful life of each asset within the pooled analysis;
3. The estimated replacement cost or deferred maintenance expense of each asset within the pooled analysis; and
4. The estimated fund balance of the pooled reserve account as of the beginning of the period for which the budget will be in effect.

(g) Include a separate schedule of any other reserve funds to be restricted by the association as a separate line item with the following minimum disclosures:

1. The intended use of the restricted funds; and
2. The estimated fund balance of the item as of the beginning of the period for which the budget will be in effect.

(2) Unrestricted expense categories. Expense categories that are not restricted as to use shall be stated in the operating portion of the budget rather than the reserve portion of the budget.

(4) Multicondominium associations. Multicondominium associations shall comply with the following requirements:

(a) Provide a separate budget for each condominium operated by the association as well as for the association. Each such budget shall disclose:

1. Estimated expenses specific to a condominium such as the maintenance, deferred maintenance or replacement of the common elements of the condominium which shall be provided for in the budget of the specific condominium;

2. Estimated expenses of the association that are not specific to a condominium such as the maintenance, deferred maintenance or replacement of the property serving more than one condominium which shall be provided for in the association budget; and

FLORIDA ADMINISTRATIVE CODE

The following an excerpt from the Florida Administrative Code Rule 61B concerning reserve budget requirements for condominium associations. This is provided for reference only and is not intended as legal advice.

3. Multicondominium associations created after June 30, 2000, or that have created separate ownership interests of the common surplus of the association for each unit as provided in Sections 718.104(4)(h) and 718.110(12), Florida Statutes, shall include each unit's share of the estimated expenses of the association, referred to in subsection (2) of this rule, which shall be shown on the individual condominium budgets. Multicondominium associations created prior to July 1, 2000, that have not created separate ownership interests of the common surplus of the association for each unit as provided in Sections 718.104(4)(h) and 718.110(12), Florida Statutes, shall include each condominium's share of the estimated expenses of the association, referred to in subsection (2) of this rule, which shall be shown on the individual condominium budgets.

4. The budgets of multicondominium associations created after June 30, 2000 or of multicondominium associations that have created separate ownership interests of the common surplus of the association for each unit as provided in Sections 718.104(4)(h) and 718.110(12), Florida Statutes, shall show the estimated revenues of each condominium and of the association.

(b) Associations that operate separate condominiums in a consolidated fashion pursuant to Section 718.111(6), Florida Statutes, may utilize a single consolidated budget.

(5) Limited common elements. If an association maintains limited common elements at the expense of only those unit owners entitled to use the limited common elements pursuant to Section 718.113(1), Florida Statutes, the budget shall include a separate schedule, or schedules, conforming to the requirements for budgets as stated in this rule, of all estimated expenses specific to each of the limited common elements, including any applicable reserves for deferred maintenance and capital expenditures. The schedule or schedules may group the maintenance expense of any limited common elements for which the declaration provides that the maintenance expense is to be shared by a group of unit owners.

(6) Phase condominium budgets. By operation of law, the annual budget of a phase condominium created pursuant to Section 718.403, Florida Statutes, shall automatically be adjusted to incorporate the change in proportionate ownership of the common elements by the purchasers and to incorporate any other changes related to the addition of phases in accordance with the declaration of condominium. The adjusted annual budget shall be effective on the date that the amendment to the declaration adding a phase to a phase condominium is recorded in the official records of the county in which the condominium is located. Notwithstanding the requirements of subsection (7) of this rule, the association shall not be required to follow the provisions of Section 718.112(2)(c), Florida Statutes, unless, as a result of the budget adjustment, the assessment per unit has changed.

(7) Budget assessment amendments. The association may amend a previously approved annual budget. In order to do so the board of administration shall follow the provisions of Section 718.112(2)(e), Florida Statutes. For example, the board shall mail a meeting notice and copies of the proposed amended annual budget to the unit owners not less than 14 days prior to the meeting at which the budget amendment will be considered.

FLORIDA ADMINISTRATIVE CODE

The following an excerpt from the Florida Administrative Code Rule 61B concerning reserve budget requirements for condominium associations. This is provided for reference only and is not intended as legal advice.

61B-22.005 Reserves.

(1) Reserves required by statute. Reserves required by Section 718.112(2)(f), Florida Statutes, for capital expenditures and deferred maintenance including roofing, painting, paving, and any other item for which the deferred maintenance expense or replacement cost exceeds \$10,000 shall be included in the budget. For the purpose of determining whether the deferred maintenance expense or replacement cost of an item exceeds \$10,000, the association may consider each asset of the association separately. Alternatively, the association may group similar or related assets together. For example, an association responsible for the maintenance of two swimming pools, each of which will separately require \$6,000 of total deferred maintenance, may establish a pool reserve, but is not required to do so.

(2) Commingling operating and reserve funds. Associations that collect operating and reserve assessments as a single payment shall not be considered to have commingled the funds provided the reserve portion of the payment is transferred to a separate reserve account, or accounts, within 30 calendar days from the date such funds were deposited.

(3) Calculating reserves required by statute. Reserves for deferred maintenance and capital expenditures required by Section 718.112(2)(f), Florida Statutes, shall be calculated using a formula that will provide funds equal to the total estimated deferred maintenance expense or total estimated replacement cost for an asset or group of assets over the remaining useful life of the asset or group of assets. Funding formulas for reserves required by Section 718.112(2)(f), Florida Statutes, shall be based on either a separate analysis of each of the required assets or a pooled analysis of two or more of the required assets.

(a) If the association maintains separate reserve accounts for each of the required assets, the amount of the current year contribution to each reserve account shall be the sum of the following two calculations:

1. The total amount necessary, if any, to bring a negative account balance to zero; and

2. The total estimated deferred maintenance expense or estimated replacement cost of the reserve asset less the estimated balance of the reserve account as of the beginning of the period for which the budget will be in effect. The remainder, if greater than zero, shall be divided by the estimated remaining useful life of the asset. The formula may be adjusted each year for changes in estimates and deferred maintenance performed during the year and may consider factors such as inflation and earnings on invested funds.

(b) If the association maintains a pooled account of two or more of the required reserve assets, the amount of the contribution to the pooled reserve account as disclosed on the proposed budget shall be not less than that required to ensure that the balance on hand at the beginning of the period for which the budget will go into effect plus the projected annual cash inflows over the remaining estimated useful lives of all of the assets that make up the reserve pool are equal to or greater than the projected annual cash outflows over the remaining estimated useful lives of all of the assets that make up the reserve pool, based on the current reserve analysis. The projected annual cash inflows may include estimated earnings from investment of principal. The reserve funding formula shall not include any type of balloon payments.

(4) Estimating reserves that are not required by statute. Reserves that are not required by Section 718.112(2)(f), Florida Statutes, are not required to be based on any specific formula.

FLORIDA ADMINISTRATIVE CODE

The following an excerpt from the Florida Administrative Code Rule 61B concerning reserve budget requirements for condominium associations. This is provided for reference only and is not intended as legal advice.

(5) Estimating non-converter reserves when the developer is funding converter reserves. For the purpose of estimating non-converter reserves, the estimated fund balance of the non-converter reserve account related to any asset for which the developer has established converter reserves pursuant to Section 718.618, Florida Statutes, shall be the sum of:

(a) The developer's total funding obligation, when all units are sold, for the converter reserve account pursuant to Section 718.618, Florida Statutes; and

(b) The estimated fund balance of the non-converter reserve account, excluding the developer's converter obligation, as of the beginning of the period for which the budget will be in effect.

(6) Timely funding. Reserves included in the adopted budget are common expenses and must be fully funded unless properly waived or reduced. Reserves shall be funded in at least the same frequency that assessments are due from the unit owners (e.g., monthly or quarterly).

(7) Restrictions on use. In a multicondominium association, no vote to allow an association to use reserve funds for purposes other than that for which the funds were originally reserved shall be effective as to a particular condominium unless conducted at a meeting at which the same percentage of voting interests in that condominium that would otherwise be required for a quorum of the association is present in person or by proxy, and a majority of those present in person or by limited proxy, vote to use reserve funds for another purpose. Expenditure of unallocated interest income earned on reserve funds is restricted to any of the capital expenditures, deferred maintenance or other items for which reserve accounts have been established.

(8) Annual vote required to waive reserves. Any vote to waive or reduce reserves for capital expenditures and deferred maintenance required by Section 718.112(2)(f)2., Florida Statutes, shall be effective for only one annual budget. Additionally, in a multicondominium association, no waiver or reduction is effective as to a particular condominium unless conducted at a meeting at which the same percentage of voting interests in that condominium that would otherwise be required for a quorum of the association is present, in person or by proxy, and a majority of those present in person or by limited proxy vote to waive or reduce reserves. For multicondominium associations in which the developer is precluded from casting its votes to waive or reduce the funding of reserves, no waiver or reduction is effective as to a particular condominium unless conducted at a meeting at which the same percentage of non-developer voting interests in that condominium that would otherwise be required for a quorum of the association is present, in person or by proxy, and a majority of those present in person or by limited proxy vote to waive or reduce reserves.

FLORIDA ADMINISTRATIVE CODE

The following an excerpt from the Florida Administrative Code Rule 61B concerning reserve budget requirements for condominium associations. This is provided for reference only and is not intended as legal advice.

61B-22.006 Financial Reporting Requirements.

(3) Disclosure requirements. The financial statements required by Sections 718.111(13) and 718.301(4), F.S., shall contain the following disclosures within the financial statements, notes, or supplementary information:

(a) The following reserve disclosures shall be made regardless of whether reserves have been waived for the fiscal period covered by the financial statements:

1. The beginning balance in each reserve account as of the beginning of the fiscal period covered by the financial statements;

2. The amount of assessments and other additions to each reserve account including authorized transfers from other reserve accounts;

3. The amount expended or removed from each reserve account, including authorized transfers to other reserve accounts;

4. The ending balance in each reserve account as of the end of the fiscal period covered by the financial statements;

5. The amount of annual funding required to fully fund each reserve account, or pool of accounts, over the remaining useful life of the applicable asset or group of assets;

6. The manner by which reserve items were estimated, the date the estimates were last made, the association's policies for allocating reserve fund interest, and whether reserves have been waived during the period covered by the financial statements; and

7. If the developer has established converter reserves pursuant to Section 718.618(1), F.S., each converter reserve account shall be identified and include the disclosures required by this rule.

(b) The method by which income and expenses were allocated to the unit owners;

(c) The specific purpose or purposes of any special assessments to unit owners pursuant to Section 718.116(10), F.S., and the amount of each special assessment and the disposition of the funds collected;

(d) The amount of revenues and expenses related to limited common elements shall be disclosed when the association maintains the limited common elements and the expense is apportioned to those unit owners entitled to the exclusive use of the limited common elements; and

(e) If a guarantee pursuant to Section 718.116(9), F.S., existed at any time during the fiscal year, the financial statements shall disclose the following:

1. The period of time covered by the guarantee;

2. The amount of common expenses incurred during the guarantee period;

3. The amount of assessments charged to the non-developer unit owners during the guarantee period;

4. The amount of non-assessment revenues earned by the association, with each non-assessment revenue generating activity disclosed separately, during the guarantee period;

5. The amount of expenses incurred in the production of non-assessment revenues, with each non-assessment revenue generating activity disclosed separately, during the guarantee period;

6. The amount of the developer's payments pursuant to the guarantee; and

7. Any financial obligation due to or from the developer resulting from the guarantee.

FLORIDA ADMINISTRATIVE CODE

The following an excerpt from the Florida Administrative Code Rule 61B concerning reserve budget requirements for condominium associations. This is provided for reference only and is not intended as legal advice.

(4) Multicondominium associations. Multicondominium associations may present the financial statements required by Sections 718.111(13) and 718.301(4), F.S., on a combined basis as long as the financial statements, notes, or supplementary information disclose the revenues, expenses, and changes in fund balance for each condominium, and the association, as applicable. The financial statements, notes, or supplementary information shall also disclose the revenues and expenses of the association that are not directly associated with specified condominiums, and the method used to allocate such expenses to the condominiums or units, as applicable. Additionally, the reserve disclosures required by this rule shall be presented separately for each condominium and for any association reserves not specifically identified with individual condominiums. The provisions of this rule shall apply to multicondominium financial reporting for fiscal periods ending on or after December 31, 2002. Earlier application of the provisions of this rule is permitted.

(5) Developer assessments. All financial reporting required by Chapter 718, F.S., shall disclose the assessment revenues from the developer separately from that of the non-developer unit owners.

(6) Financial reports required by Section 718.111(13)(b), F.S.. The financial report required by Section 718.111(13)(b), F.S., shall meet the following requirements:

(a) The report shall be prepared using a cash basis method of accounting.

(b) The report shall include the reserve disclosures required by paragraph 61B-22.006(3)(a), F.A.C.

(c) The report shall include the special assessment disclosure required by paragraph 61B-22.006(3)(c), F.A.C.

(d) If the association maintains limited common elements and the expense is apportioned to those units entitled to the exclusive use of the limited common elements the report shall contain the limited common element disclosures required by paragraph 61B-22.006(3)(d), F.A.C.

(e) The financial reports of multicondominium associations shall separately disclose the following items:

1. The receipts and expenditures directly associated with specific condominiums; and

2. The receipts and expenditures of the association that are not directly associated with specific condominiums.

(7) The minutes of the association shall reflect the number of votes cast by the membership to waive the requirement for audited, reviewed, or compiled financial statements and the type of financial reporting that the association will be preparing and disseminating to the membership.

LCAM RESOURCES

Thank You

We truly appreciate you allowing LCAM Resources the opportunity to serve you, and hope that you have been pleased with our service.

In an effort to improve our services, we would be very interested in hearing any comments, suggestions or criticisms that you may have. A letter, fax or email would be greatly appreciated!

**LCAM Resources**

Reserve Studies & Insurance Appraisals

5036 Dr. Phillips Boulevard, Suite #207, Orlando, FL 32819

Toll Free Tel: 1-800-566-1770 • Toll Free Fax: 1-877-271-7719

Email: info@lcamresources.com • www.lcamresources.com